


CALIBRATING FOR WIDE LINEAR RANGE WITH ADJUSTABLE MODELS TO STANDARD THERMOCOUPLE INPUTS

All IRt/c models with the “A” designator (example: IRt/c.10A-K-Lo E) are equipped with a calibration adjustment feature that makes it possible to precisely calibrate the IRt/c to the temperature control requirements. However, for installations in which monitoring of temperature rather than control is desired, a wide linear range is convenient. Accordingly, the procedure described below can be used to produce a very wide linear range when using controllers, meters, PLCs, transmitters, etc. for temperature monitoring. The only requirement is that an OFFSET, ZERO, LO CAL, or equivalent adjustment be available to offset the reading.

The method involves simply “rotating” the output curve of the IRt/c to better fit the linear thermocouple requirement over a wider temperature range, as shown in the graph. The steps are as follows:

1. Set the readout device to the offset value shown in Table I.
2. Adjust the calibration screw on the IRt/c to the correct target temperature.
3. Calibration complete.

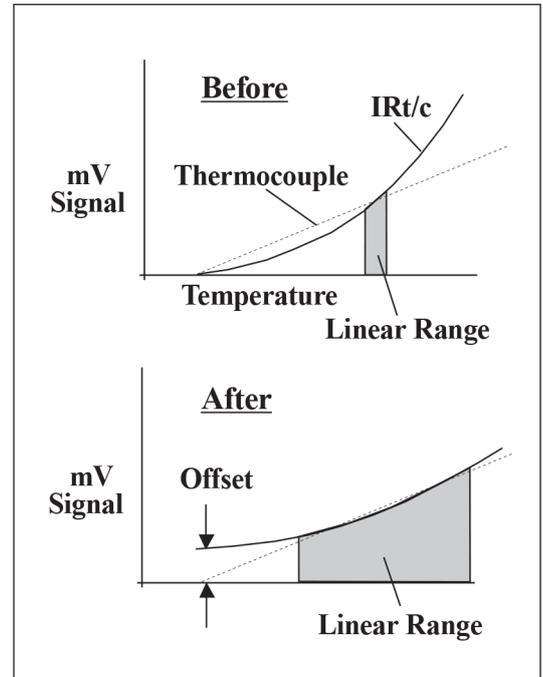

Models: IRt/c.xxxA (Applies to all Adjustable Models)	Target Temperature °F (°C)	Optimum Offset (% of Target Temperature)	Approximate 2% Linear Range (from Target Temperature), °F (°C)
Lo E	800 (425)	~ 75%	± 100 (60)
	1000 (540)	~ 75%	± 150 (80)
	1600 (870)	~ 75%	± 200 (110)
	2000 (1100)	~ 75%	± 300 (170)
	2800 (1540)	~ 75%	± 400 (220)
	3600 (2000)	~ 75%	± 400 (220)
Hi E	200 (90)	~ 60%	± 25 (15)
	500 (260)	~ 60%	± 50 (30)
	1000 (540)	~ 60%	± 200 (110)
	1500 (820)	~ 60%	± 500 (280)
	2100 (1150)	~ 60%	± 600 (330)
	3000 (1650)	~ 50%	± 800 (440)

Example: Apply a Lo E model to monitor steel at 1800°F (980°C). Cover the IRt/c with aluminum foil such that it cannot see the target, then set the readout device offset so that the display reads approximately 75% of target temperature: $.75 \times 1800 = 1350^\circ\text{F}$ ($.75 \times 980 = 735^\circ\text{C}$). Remove foil, point IRt/c at intended target, and adjust the calibration screw on the back of the IRt/c until the readout display reads the correct temperature, or within a few percent of the correct temperature. Fine tune the reading at the readout device as required. The calibration is complete, and the linear range over which the reading will be within 2% of actual is approximately $1800^\circ\text{F} \pm 250^\circ\text{F}$ ($980^\circ\text{C} \pm 140^\circ\text{C}$).

Exergen Global offices:

The Netherlands
Pastoor Clercxstraat 26
5465 RH Veghel
Tel: +31(0) 413 37 65 99
Fax: +31(0) 413 37 93 10

USA
400 Pleasant Street
Watertown, MA 02472
Tel: +1 617 649 6322
Fax: +1 617 923 9911

office@exergenglobal.com
www.exergenglobal.com